

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME

Davco Lanko 136 Rapid Patching Mortar

PRODUCT USE

Polymer-modified rapid setting mortar designed for making repair to internal concrete and masonry surfaces.

SUPPLIER

Company: ParexDavco

Address:

67 Elizabeth Street

Wetherill Park

NSW, 2164

AUS

Telephone: +61 2 9616 3000

Emergency Tel: 1800 807 001


Fax: +61 2 9725 5551

Email: marketing@davco.com.au

HAZARD RATINGS

	Min	Max
Flammability:	1	
Toxicity:	2	
Body Contact:	3	
Reactivity:	1	
Chronic:	3	

Min/Nil=0
Low=1
Moderate=2
High=3
Extreme=4

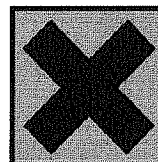

Section 2 - HAZARDS IDENTIFICATION

STATEMENT OF HAZARDOUS NATURE

HAZARDOUS SUBSTANCE. NON-DANGEROUS GOODS. According to the Criteria of NOHSC, and the ADG Code.

POISONS SCHEDULE

None

RISK

- Risk of serious damage to eyes.
- Harmful: danger of serious damage to health by prolonged exposure through inhalation.
- Inhalation may produce health damage*.
- Cumulative effects may result following exposure*.
- Possible respiratory and skin sensitiser*.
- Possible cancer-causing agent following repeated inhalation*.

* (limited evidence).

SAFETY

- Use only in well ventilated areas.
- Keep container in a well ventilated place.
- Avoid exposure - obtain special instructions before use.
- To clean the floor and all objects contaminated by this material use water and detergent.
- Keep away from food drink and animal feeding stuffs.
- In case of contact with eyes rinse with plenty of water and contact Doctor or Poisons Information Centre.
- If swallowed IMMEDIATELY contact Doctor or Poisons Information Centre (show this container or label).

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME

CAS RN

%

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

<u>silica crystalline - quartz</u>	14808-60-7	30-60
<u>portland cement</u>	65997-15-1	10-30
<u>limestone</u>	1317-65-3	10-30
nonhazardous ingredients		balance

Section 4 - FIRST AID MEASURES

SWALLOWED

-
- If swallowed do NOT induce vomiting.
- If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
- Observe the patient carefully.
- Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.
- Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.
- Seek medical advice.

EYE

- If this product comes in contact with the eyes:
 - Wash out immediately with fresh running water.
 - Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
 - If pain persists or recurs seek medical attention.
 - Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

- If skin contact occurs:
 - Immediately remove all contaminated clothing, including footwear.
 - Flush skin and hair with running water (and soap if available).
 - Seek medical attention in event of irritation.

INHALED

-
- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor.

NOTES TO PHYSICIAN

- Treat symptomatically.

Section 5 - FIRE FIGHTING MEASURES

EXTINGUISHING MEDIA

-
- There is no restriction on the type of extinguisher which may be used.
- Use extinguishing media suitable for surrounding area.

FIRE FIGHTING

-
- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves for fire only.
- Prevent, by any means available, spillage from entering drains or water courses.
- Use fire fighting procedures suitable for surrounding area.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

FIRE/EXPLOSION HAZARD

-
- Solid which exhibits difficult combustion or is difficult to ignite.

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

- Avoid generating dust, particularly clouds of dust in a confined or unventilated space as dusts may form an explosive mixture with air, and any source of ignition, i.e. flame or spark, will cause fire or explosion.
- Dust clouds generated by the fine grinding of the solid are a particular hazard; accumulations of fine dust (420 micron or less) may burn rapidly and fiercely if ignited; once initiated larger particles up to 1400 microns diameter will contribute to the propagation of an explosion.
- A dust explosion may release of large quantities of gaseous products; this in turn creates a subsequent pressure rise of explosive force capable of damaging plant and buildings and injuring people.
- Usually the initial or primary explosion takes place in a confined space such as plant or machinery, and can be of sufficient force to damage or rupture the plant. If the shock wave from the primary explosion enters the surrounding area, it will disturb any settled dust layers, forming a second dust cloud, and often initiate a much larger secondary explosion. All large scale explosions have resulted from chain reactions of this type.
- Dry dust can also be charged electrostatically by turbulence, pneumatic transport, pouring, in exhaust ducts and during transport.
- Build-up of electrostatic charge may be prevented by bonding and grounding.
- Powder handling equipment such as dust collectors, dryers and mills may require additional protection measures such as explosion venting.
- All movable parts coming in contact with this material should have a speed of less than 1-metre/sec.

Combustion products include: carbon monoxide (CO), carbon dioxide (CO₂), silicon dioxide (SiO₂), other pyrolysis products typical of burning organic material.

May emit poisonous fumes.

May emit corrosive fumes.

FIRE INCOMPATIBILITY

- - Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches, pool chlorine etc. as ignition may result

HAZCHEM

None

Personal Protective Equipment

Gas tight chemical resistant suit.

Section 6 - ACCIDENTAL RELEASE MEASURES

EMERGENCY PROCEDURES

MINOR SPILLS

- - Remove all ignition sources.
 - Clean up all spills immediately.
 - Avoid contact with skin and eyes.
 - Control personal contact by using protective equipment.
 - Use dry clean up procedures and avoid generating dust.
 - Place in a suitable, labelled container for waste disposal.

MAJOR SPILLS

- Moderate hazard.
 - CAUTION: Advise personnel in area.
 - Alert Emergency Services and tell them location and nature of hazard.
 - Control personal contact by wearing protective clothing.
 - Prevent, by any means available, spillage from entering drains or water courses.
 - Recover product wherever possible.
 - IF DRY: Use dry clean up procedures and avoid generating dust. Collect residues and place in sealed plastic bags or other containers for disposal. IF WET: Vacuum/shovel up and place in labelled containers for disposal.
 - ALWAYS: Wash area down with large amounts of water and prevent runoff into drains.
 - If contamination of drains or waterways occurs, advise Emergency Services.

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE

PROCEDURE FOR HANDLING

- - Avoid all personal contact, including inhalation.
 - Wear protective clothing when risk of exposure occurs.

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- DO NOT allow material to contact humans, exposed food or food utensils.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately. Launder contaminated clothing before re-use.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.

SUITABLE CONTAINER

- Multi-ply paper bag with sealed plastic liner or heavy gauge plastic bag.

NOTE: Bags should be stacked, blocked, interlocked, and limited in height so that they are stable and secure against sliding or collapse. Check that all containers are clearly labelled and free from leaks. Packing as recommended by manufacturer.


STORAGE INCOMPATIBILITY

-
- Avoid reaction with oxidising agents

STORAGE REQUIREMENTS

-
- Store in original containers.
- Keep containers securely sealed.
- Store in a cool, dry, well-ventilated area.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations.

SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS

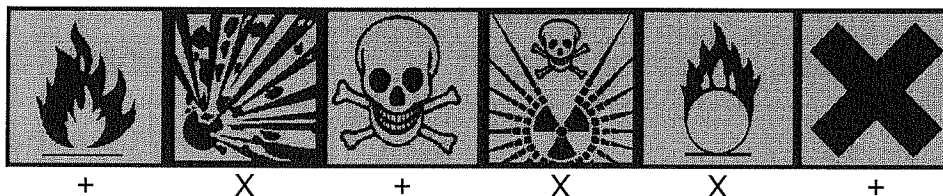

X: Must not be stored together

O: May be stored together with specific preventions

+: May be stored together

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EXPOSURE CONTROLS

Source	Material	TWA ppm	TWA mg/m ³	STEL ppm	STEL mg/m ³	Peak ppm	Peak mg/m ³	TWA F/CC	Notes
Australia Exposure Standards	silica crystalline - quartz (Silica - Crystalline Quartz)		0.1						(see Chapter 14)
Australia Exposure Standards	silica crystalline - quartz (Silica - Amorphous Fumed silica (respirable dust))		2						(see Chapter 14)
Australia Exposure Standards	portland cement (Portland cement (a))		10						(see Chapter 14)
Australia Exposure Standards	limestone (Calcium carbonate (a))		10						(see Chapter 14)

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m3)	Revised IDLH Value (ppm)
silica crystalline - quartz	50	
portland cement	5,000	

MATERIAL DATA

DAVCO LANKO 136 RAPID PATCHING MORTAR:

■ It is the goal of the ACGIH (and other Agencies) to recommend TLVs (or their equivalent) for all substances for which there is evidence of health effects at airborne concentrations encountered in the workplace.

At this time no TLV has been established, even though this material may produce adverse health effects (as evidenced in animal experiments or clinical experience). Airborne concentrations must be maintained as low as is practically possible and occupational exposure must be kept to a minimum.

NOTE: The ACGIH occupational exposure standard for Particles Not Otherwise Specified (P.N.O.S) does NOT apply.

Sensory irritants are chemicals that produce temporary and undesirable side-effects on the eyes, nose or throat. Historically occupational exposure standards for these irritants have been based on observation of workers' responses to various airborne concentrations. Present day expectations require that nearly every individual should be protected against even minor sensory irritation and exposure standards are established using uncertainty factors or safety factors of 5 to 10 or more. On occasion animal no-observable-effect-levels (NOEL) are used to determine these limits where human results are unavailable. An additional approach, typically used by the TLV committee (USA) in determining respiratory standards for this group of chemicals, has been to assign ceiling values (TLV C) to rapidly acting irritants and to assign short-term exposure limits (TLV STELs) when the weight of evidence from irritation, bioaccumulation and other endpoints combine to warrant such a limit. In contrast the MAK Commission (Germany) uses a five-category system based on intensive odour, local irritation, and elimination half-life. However this system is being replaced to be consistent with the European Union (EU) Scientific Committee for Occupational Exposure Limits (SCOEL); this is more closely allied to that of the USA.

OSHA (USA) concluded that exposure to sensory irritants can:

- cause inflammation
- cause increased susceptibility to other irritants and infectious agents
- lead to permanent injury or dysfunction
- permit greater absorption of hazardous substances and
- acclimate the worker to the irritant warning properties of these substances thus increasing the risk of overexposure.

SILICA CRYSTALLINE - QUARTZ:

■ The concentration of dust, for application of respirable dust limits, is to be determined from the fraction that penetrates a separator whose size collection efficiency is described by a cumulative log-normal function with a median aerodynamic diameter of 4.0 µm (+-) 0.3 µm and with a geometric standard deviation of 1.5 µm (+-) 0.1 µm, i.e. generally less than 5 µm.

Because the margin of safety of the quartz TLV is not known with certainty and given the associated link between silicosis and lung cancer it is recommended that quartz concentrations be maintained as far below the TLV as prudent practices will allow.

PORTLAND CEMENT:

■ Sensory irritants are chemicals that produce temporary and undesirable side-effects on the eyes, nose or throat. Historically occupational exposure standards for these irritants have been based on observation of workers' responses to various airborne concentrations. Present day expectations require that nearly every individual should be protected against even minor sensory irritation and exposure standards are established using uncertainty factors or safety factors of 5 to 10 or more. On occasion animal no-observable-effect-levels (NOEL) are used to determine these limits where human results are unavailable. An additional approach, typically used by the TLV committee (USA) in determining respiratory standards for this group of chemicals, has been to assign ceiling values (TLV C) to rapidly acting irritants and to assign short-term exposure limits (TLV STELs) when the weight of evidence from irritation, bioaccumulation and other endpoints combine to warrant such a limit. In contrast the MAK Commission (Germany) uses a five-category system based on intensive odour, local irritation, and elimination half-life. However this system is being replaced to be consistent with the European Union (EU) Scientific Committee for Occupational Exposure Limits (SCOEL); this is more closely allied to that of the USA.

OSHA (USA) concluded that exposure to sensory irritants can:

- cause inflammation
- cause increased susceptibility to other irritants and infectious agents
- lead to permanent injury or dysfunction
- permit greater absorption of hazardous substances and
- acclimate the worker to the irritant warning properties of these substances thus increasing the risk of overexposure.

Portland cement is considered to be a nuisance dust that does not cause fibrosis and has little potential to induce adverse effects on the lung.

LIMESTONE:

■ Sensory irritants are chemicals that produce temporary and undesirable side-effects on the eyes, nose or throat. Historically occupational exposure standards for these irritants have been based on observation of workers' responses to various airborne concentrations. Present day expectations require that nearly every individual should be protected against even minor sensory irritation and exposure standards are established using uncertainty factors or safety factors of 5 to 10 or more. On occasion animal no-observable-effect-levels (NOEL) are used to determine these limits where human results are unavailable. An additional approach, typically used by the TLV committee (USA) in determining respiratory standards for this group of chemicals, has been to assign ceiling values (TLV C) to rapidly acting irritants and to assign short-term exposure limits (TLV STELs) when the weight of evidence from irritation, bioaccumulation and other endpoints combine to warrant such a limit. In contrast the MAK Commission (Germany) uses a five-category system based on intensive odour, local irritation, and elimination half-life. However this system is being replaced to be consistent with the European Union (EU) Scientific Committee for Occupational Exposure Limits (SCOEL); this is more closely allied to

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007



CD 2009/3

that of the USA.

OSHA (USA) concluded that exposure to sensory irritants can:

- cause inflammation
- cause increased susceptibility to other irritants and infectious agents
- lead to permanent injury or dysfunction
- permit greater absorption of hazardous substances and
- acclimate the worker to the irritant warning properties of these substances thus increasing the risk of overexposure.

PERSONAL PROTECTION

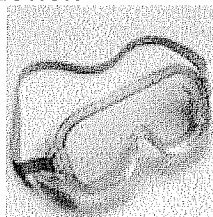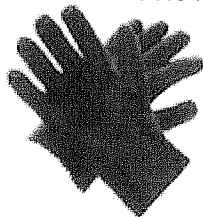

EYE

-
- Chemical goggles.
- Full face shield may be required for supplementary but never for primary protection of eyes
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59]

HANDS/FEET

NOTE:

- The material may produce skin sensitisation in predisposed individuals. Care must be taken, when removing gloves and other protective equipment, to avoid all possible skin contact.
- Contaminated leather items, such as shoes, belts and watch-bands should be removed and destroyed.

Suitability and durability of glove type is dependent on usage. Factors such as:

- frequency and duration of contact,
- chemical resistance of glove material,
- glove thickness and
- dexterity,

are important in the selection of gloves.

Experience indicates that the following polymers are suitable as glove materials for protection against undissolved, dry solids, where abrasive particles are not present.

- polychloroprene
- nitrile rubber
- butyl rubber
- fluoroacoutchouc
- polyvinyl chloride

Gloves should be examined for wear and/ or degradation constantly.

OTHER

-
- Overalls.
- P.V.C. apron.
- Barrier cream.
- Skin cleansing cream.
- Eye wash unit.

RESPIRATOR

Protection Factor	Half-Face Respirator	Full-Face Respirator	Powered Air Respirator
10 x ES	AX P1 Air-line*	--	AX PAPER-P1 -
50 x ES	Air-line**	AX P2	AX PAPER-P2
100 x ES	-	AX P3	-
		Air-line*	-
100+ x ES	-	Air-line**	AX PAPER-P3

* - Negative pressure demand ** - Continuous flow.

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

ENGINEERING CONTROLS

- General exhaust is adequate under normal operating conditions.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Grey powder with a cement-like odour; insoluble in water.

PHYSICAL PROPERTIES

Does not mix with water.

Sinks in water.

Molecular Weight: Not Available

Boiling Range (°C): Not Available

Melting Range (°C): Not Available

Specific Gravity (water=1): 1.6

Solubility in water (g/L): Immiscible

pH (as supplied): Not Applicable

pH (1% solution): Not Applicable

Vapour Pressure (kPa): Not Available

Volatile Component (%vol): Not Available

Evaporation Rate: Not Applicable

Relative Vapour Density (air=1): Not Available

Flash Point (°C): Not Applicable

Lower Explosive Limit (%): Not Applicable

Upper Explosive Limit (%): Not Applicable

Autoignition Temp (°C): Not Applicable

Decomposition Temp (°C): Not Available

State: Divided Solid

Viscosity: Not Applicable

Section 10 - CHEMICAL STABILITY

CONDITIONS CONTRIBUTING TO INSTABILITY

-
- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

For incompatible materials - refer to Section 7 - Handling and Storage.

Section 11 - TOXICOLOGICAL INFORMATION

POTENTIAL HEALTH EFFECTS

ACUTE HEALTH EFFECTS

SWALLOWED

- The material may produce chemical burns within the oral cavity and gastrointestinal tract following ingestion.

EYE

- If applied to the eyes, this material causes severe eye damage.

The material may produce chemical burns to the eye following direct contact. Vapours or mists may be extremely irritating.

SKIN

- Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

The material may produce chemical burns following direct contact with the skin.

There is some evidence to suggest that the material may cause moderate inflammation of the skin either following direct contact or after a delay of some time. Repeated exposure can cause contact dermatitis which is characterised by redness, swelling and blistering.

INHALED

- Inhalation of dusts, generated by the material during the course of normal handling, may be damaging to the health of the individual. Acute silicosis occurs under conditions of extremely high silica dust exposure particularly when the particle size of the dust is small. The disease is rapidly progressive and spreads widely through the lungs within months of the initial exposure and causing death within 1 to 2 years.

Effects on lungs are significantly enhanced in the presence of respirable particles.

CHRONIC HEALTH EFFECTS

- Harmful: danger of serious damage to health by prolonged exposure through inhalation.

This material can cause serious damage if one is exposed to it for long periods. It can be assumed that it contains a substance which can produce severe defects. This has been demonstrated via both short- and long-term experimentation.

On the basis of epidemiological data, it has been concluded that prolonged inhalation of the material, in an occupational setting, may

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

produce cancer in humans.

Substance accumulation, in the human body, may occur and may cause some concern following repeated or long-term occupational exposure.

There is some evidence that inhaling this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

There is limited evidence that, skin contact with this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

Overexposure to respirable dust may cause coughing, wheezing, difficulty in breathing and impaired lung function. Chronic symptoms may include decreased vital lung capacity, chest infections

Repeated exposures, in an occupational setting, to high levels of fine- divided dusts may produce a condition known as pneumoconiosis which is the lodgement of any inhaled dusts in the lung irrespective of the effect. This is particularly true when a significant number of particles less than 0.5 microns (1/50,000 inch), are present. Lung shadows are seen in the X-ray. Symptoms of pneumoconiosis may include a progressive dry cough, shortness of breath on exertion (exertional dyspnea), increased chest expansion, weakness and weight loss. As the disease progresses the cough produces a stringy mucus, vital capacity decreases further and shortness of breath becomes more severe. Other signs or symptoms include altered breath sounds, diminished lung capacity, diminished oxygen uptake during exercise, emphysema and pneumothorax (air in lung cavity) as a rare complication.

Removing workers from possibility of further exposure to dust generally leads to halting the progress of the lung abnormalities. Where worker-exposure potential is high, periodic examinations with emphasis on lung dysfunctions should be undertaken

Dust inhalation over an extended number of years may produce pneumoconiosis.. Pneumoconiosis is the accumulation of dusts in the lungs and the tissue reaction in its presence. It is further classified as being of noncollagenous or collagenous types. Noncollagenous pneumoconiosis, the benign form, is identified by minimal stromal reaction, consists mainly of reticulin fibres, an intact alveolar architecture and is potentially reversible.

TOXICITY AND IRRITATION

■ Not available. Refer to individual constituents.

SILICA CRYSTALLINE - QUARTZ:

■ unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

TOXICITY

Inhalation (human) LCLo: 0.3 mg/m³/10Y

Inhalation (human) TCLo: 16 mppcf*8H/17.9Y

Inhalation (rat) TCLo: 50 mg/m³/6H/71W

■ **WARNING:** For inhalation exposure ONLY: This substance has been classified by the IARC as Group 1: CARCINOGENIC TO HUMANS.

Intermittent; focal fibrosis,

(pneumoconiosis), cough, dyspnoea

Intermittent; liver - tumours.

* Millions of particles per cubic foot (based on impinger samples counted by light field techniques).

NOTE : the physical nature of quartz in the product determines whether

it is likely to present a chronic health problem. To be a hazard

the material must enter the breathing zone as respirable particles.

PORTLAND CEMENT:

■ unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

■ Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound. Key criteria for the diagnosis of RADS include the absence of preceding respiratory disease, in a non-atopic individual, with abrupt onset of persistent asthma-like symptoms within minutes to hours of a documented exposure to the irritant. A reversible airflow pattern, on spirometry, with the presence of moderate to severe bronchial hyperreactivity on methacholine challenge testing and the lack of minimal lymphocytic inflammation, without eosinophilia, have also been included in the criteria for diagnosis of RADS. RADS (or asthma) following an irritating inhalation is an infrequent disorder with rates related to the concentration of and duration of exposure to the irritating substance. Industrial bronchitis, on the other hand, is a disorder that occurs as result of exposure due to high concentrations of irritating substance (often particulate in nature) and is completely reversible after exposure ceases. The disorder is characterised by dyspnea, cough and mucus production.

LIMESTONE:

■ unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

TOXICITY

Oral (rat) LD50: 6450 mg/kg

IRRITATION

Skin (rabbit): 500 mg/24h-Moderate

Eye (rabbit) 0.75: mg/24h -

■ The material may produce severe irritation to the eye causing pronounced inflammation. Repeated or prolonged exposure to irritants may produce conjunctivitis.

The material may cause skin irritation after prolonged or repeated exposure and may produce on contact skin redness, swelling, the production of vesicles, scaling and thickening of the skin.

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

No evidence of carcinogenic properties.
teratogenic effects.

No evidence of mutagenic or

CARCINOGEN

Silica, crystalline (inhaled in the form of quartz or cristobalite from occupational sources)

International Agency for Research on Cancer (IARC) - Agents Reviewed by the IARC Monographs

Group 1

Silica, amorphous

International Agency for Research on Cancer (IARC) - Agents Reviewed by the IARC Monographs

Group 3

Section 12 - ECOLOGICAL INFORMATION

Refer to data for ingredients, which follows:
 DAVCO LANKO 136 RAPID PATCHING MORTAR:
 LIMESTONE:
 PORTLAND CEMENT:
 SILICA CRYSTALLINE - QUARTZ:
 ■ DO NOT discharge into sewer or waterways.
 DAVCO LANKO 136 RAPID PATCHING MORTAR:
 SILICA CRYSTALLINE - QUARTZ:
 ■ For silica:

The literature on the fate of silica in the environment concerns dissolved silica in the aquatic environment, irrespective of its origin (man-made or natural), or structure (crystalline or amorphous). Indeed, once released and dissolved into the environment no distinction can be made between the initial forms of silica. At normal environmental pH, dissolved silica exists exclusively as monosilicic acid [Si(OH)₄]. At pH 9.4 the solubility of amorphous silica is about 120 mg SiO₂/l. Quartz has a solubility of only 6 mg/l, but its rate of dissolution is so slow at ordinary temperature and pressure that the solubility of amorphous silica represents the upper limit of dissolved silica concentration in natural waters. Moreover, silicic acid is the bioavailable form for aquatic organisms and it plays an important role in the biogeochemical cycle of Si, particularly in the oceans.

In the oceans, the transfer of dissolved silica from the marine hydrosphere to the biosphere initiates the global biological silicon cycle. Marine organisms such as diatoms, silicoflagellates and radiolarians build up their skeletons by taking up silicic acid from seawater. After these organisms die, the biogenic silica accumulated in them partly dissolves. The portion of the biogenic silica that does not dissolve settles and ultimately reaches the sediment. The transformation of opal (amorphous biogenic silica) deposits in sediments through diagenetic processes allows silica to re-enter the geological cycle. Silica is labile between the water and sediment interface.

Ecotoxicity:

Fish LC50 (96 h): Brachydanio rerio >10000 mg/l; zebra fish >10000 mg/l
 Daphnia magna EC50 (24 h): >1000 mg/l; LC50 924 h): >10000 mg/l.

■ Metal-containing inorganic substances generally have negligible vapour pressure and are not expected to partition to air. Once released to surface waters and moist soils their fate depends on solubility and dissociation in water. Environmental processes (such as oxidation and the presence of acids or bases) may transform insoluble metals to more soluble ionic forms. Microbiological processes may also transform insoluble metals to more soluble forms. Such ionic species may bind to dissolved ligands or sorb to solid particles in aquatic or aqueous media. A significant proportion of dissolved/ sorbed metals will end up in sediments through the settling of suspended particles. The remaining metal ions can then be taken up by aquatic organisms.

When released to dry soil most metals will exhibit limited mobility and remain in the upper layer; some will leach locally into ground water and/ or surface water ecosystems when soaked by rain or melt ice. Environmental processes may also be important in changing solubilities.

Even though many metals show few toxic effects at physiological pHs, transformation may introduce new or magnified effects.

A metal ion is considered infinitely persistent because it cannot degrade further.

The current state of science does not allow for an unambiguous interpretation of various measures of bioaccumulation.

The counter-ion may also create health and environmental concerns once isolated from the metal. Under normal physiological conditions the counter-ion may be essentially insoluble and may not be bioavailable.

Environmental processes may enhance bioavailability.

PORTLAND CEMENT:

LIMESTONE:

Ecotoxicity

Ingredient	Persistence: Water/Soil	Persistence: Air	Bioaccumulation	Mobility
Davco Lanko 136 Rapid Patching Mortar silica crystalline - quartz portland	LOW	No data	LOW	HIGH

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

cement	data
limestone	No data

Section 13 - DISPOSAL CONSIDERATIONS

■ Legislation addressing waste disposal requirements may differ by country, state and/ or territory. Each user must refer to laws operating in their area. In some areas, certain wastes must be tracked.

A Hierarchy of Controls seems to be common - the user should investigate:

- Reduction,
- Reuse
- Recycling
- Disposal (if all else fails)

This material may be recycled if unused, or if it has not been contaminated so as to make it unsuitable for its intended use. Shelf life considerations should also be applied in making decisions of this type. Note that properties of a material may change in use, and recycling or reuse may not always be appropriate.

- DO NOT allow wash water from cleaning or process equipment to enter drains.
- It may be necessary to collect all wash water for treatment before disposal.
- In all cases disposal to sewer may be subject to local laws and regulations and these should be considered first.
- Where in doubt contact the responsible authority.
- Recycle wherever possible.
- Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
- Dispose of by: Burial in a licenced land-fill or Incineration in a licenced apparatus (after admixture with suitable combustible material)
- Decontaminate empty containers. Observe all label safeguards until containers are cleaned and destroyed.

Section 14 - TRANSPORTATION INFORMATION

HAZCHEM: None (ADG6)

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS: UN, IATA, IMDG

Section 15 - REGULATORY INFORMATION

POISONS SCHEDULE

None

REGULATIONS

Regulations for ingredients

silica crystalline - quartz (CAS: 14808-60-7,122304-48-7,122304-49-8,12425-26-2,1317-79-9,70594-95-5,87347-84-0) is found on the following regulatory lists;

"Australia - New South Wales Hazardous Substances Prohibited for Specific Uses","Australia - New South Wales Hazardous Substances Requiring Health Surveillance","Australia - South Australia Hazardous Substances Requiring Health Surveillance","Australia - Tasmania Hazardous Substances Prohibited for Specified Uses","Australia - Tasmania Hazardous Substances Requiring Health Surveillance","Australia - Western Australia Hazardous Substances Requiring Health Surveillance","Australia Exposure Standards","Australia Hazardous Substances","Australia Hazardous Substances Requiring Health Surveillance","Australia High Volume Industrial Chemical List (HVICL)","Australia Inventory of Chemical Substances (AICS)","Australia Occupational Health and Safety (Commonwealth Employment) (National Standards) Regulations 1994 - Hazardous Substances Requiring Health Surveillance","International Agency for Research on Cancer (IARC) - Agents Reviewed by the IARC Monographs","OECD Representative List of High Production Volume (HPV) Chemicals"

portland cement (CAS: 65997-15-1) is found on the following regulatory lists;

"Australia Exposure Standards","Australia High Volume Industrial Chemical List (HVICL)","Australia Inventory of Chemical Substances (AICS)","OECD Representative List of High Production Volume (HPV) Chemicals"

limestone (CAS: 1317-65-3) is found on the following regulatory lists;

"Australia Exposure Standards","Australia Inventory of Chemical Substances (AICS)","OECD Representative List of High Production Volume (HPV) Chemicals"

No data for Davco Lanko 136 Rapid Patching Mortar (CW: 8809-38)

Section 16 - OTHER INFORMATION

DAVCO LANKO 136 RAPID PATCHING MORTAR

Hazard Alert Code:
HIGH

Chemwatch Material Safety Data Sheet (REVIEW)

Revision No: 2.0

Chemwatch 8809-38

Issue Date: 20-Jul-2007

CD 2009/3

Ingredients with multiple CAS Nos

Ingredient Name	CAS
silica crystalline - quartz	14808-60-7, 122304-48-7, 122304-49-8, 12425-26-2, 1317-79-9, 70594-95-5, 87347-84-0

■ Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:
www.chemwatch.net/references.

■ The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

Issue Date: 20-Jul-2007

Print Date: 16-Nov-2009